




# PVC WATERSTOP – SPLICING & INSTALLATION

## PVC WATERSTOP - SPLICING INFORMATION & INSTALLATION

### INTRODUCTION

Following is the proper procedure, as recommended by Sika, for field splicing PVC waterstops:

1. Provide factory fabricated corners, intersections and transitions, leaving only straight butt joint splices for the field.
2. Use a worktable to create field splices. Table should be solid, have access to 110 V power supply and have jigs and fixtures to aid splicing.
3. Cut ends square, using a razor knife or circular saw equipped with a carbide tipped blade [250 mm (10 in) diameter with 40 teeth]. This will ensure matching edges.
4. Preheat Teflon covered Sika® Greenstreak Splicing Iron to approx. 193 °C (380 °F).
5. Press ends of cut waterstop firmly against the preheated iron. Maintain pressure until approximately 3 mm (1/8 in) of melted waterstop material appears at the iron surface.
6. Quickly remove Splicing Iron and hold PVC waterstop ends tightly together until they bond (approximately 60 seconds). Note: Water may be used to cool the material quickly. If you do not join the ends quickly, the melt bead will skin over, resulting in an inadequate bond. Do not move, bend, stretch or stress the splice before the 60 second bond time.
7. When fabricating waterstop into horizontal tees, ells or crosses, always miter the ends at an appropriate angle (typically 45-degrees) so the continuity of the ribs and and/or centerbulb is maintained. This will also produce a much stronger joint. Factory fabricated corners, intersections and transitions are strongly recommended.

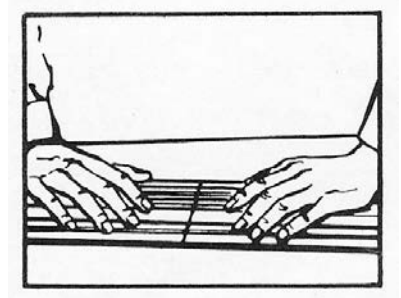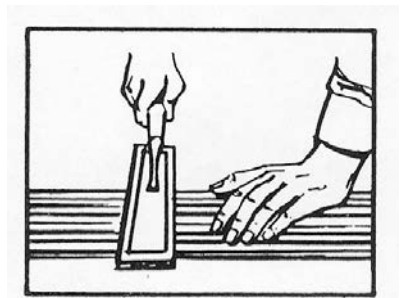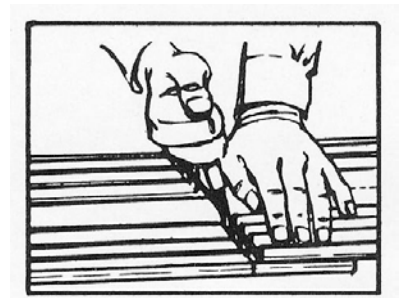

**SPECIAL SAFETY NOTE:** When splicing PVC waterstop with a heated splicing iron, inhalation of the fumes may be harmful to your health. Splicing should be done only outside or in areas with adequate ventilation.

### QUALITY ASSURANCE

Waterstop splicing defects which are unacceptable include, but are not limited to the following:

- Tensile strength less than 80 % of parent section
- Use of adhesives, solvents or free lap joints
- Misalignment of centerbulb greater than 1.5 mm (1/16 in)
- Misalignment that reduces waterstop cross-section area more than 15 %
- Bond failure at joint, deeper than 1.5 mm (1/16 in) or 15 % of material thickness
- Combination misalignment and bond failure with net reduction of waterstop cross-section area greater than 15 %



- Misalignment of waterstop splice resulting in misalignment of waterstop in excess of 12 mm (½ in) in 3 m (10 ft)
- Visible porosity in the welded joint, including pinholes
- Charred or burnt material
- Bubbles or inadequate bonding detectable with a penknife. If while prodding the entire joint with the penknife, the knife breaks through the outer portion of the weld into a bubble, the joint shall be considered defective. The industry is not using the spark test because the test by itself is not a good indication of high quality welds in waterstop. For example, a 4 mm (3/16 in) thick waterstop could have a poor weld by only 1.5 mm (1/16 in), resulting in a net tensile strength of 33 % of the parent material. This unacceptable weld will pass the spark test.
- Visible signs of splice separation when cooled splices are bent by hand at sharp angle
- Edge welding

Provide destructive sampling of waterstop field welds at intervals determined by field engineer. A minimum of one (1) field weld at the beginning and end of each day should be sampled. Make 6 mm (¼ in) slices perpendicular to the weld on one half of the waterstop. Slice the remaining half along the weld. Welded section should exhibit consistency of material, and lack of porosity and charring. Welded material should not be noticeably different appearance from the parent material.

**Sika Canada Inc.**  
Head Office  
601, Avenue Delmar  
Pointe-Claire, Quebec  
H9R 4A9

**Other locations**  
Boisbriand (QC)  
Brantford; Cambridge;  
Sudbury; Toronto (ON)  
Edmonton (AB) Surrey (BC)

**1-800-933-SIKA**  
**[www.sika.ca](http://www.sika.ca)**